




## UNIVERSAL BARGRAPH

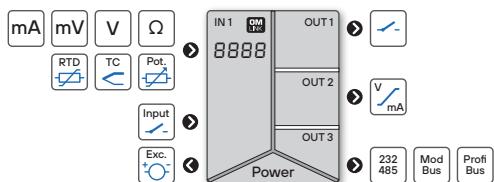

## OPERATION

The instrument is set and controlled by five buttons located on the front panel. All programmable settings of the instrument may be performed in three adjusting modes:

**LIGHT MENU** is protected by optional number code and contains solely items necessary for instrument setting.

**PROFI MENU** is protected by optional number code and contains complete instrument setting.

**USER MENU** may contain arbitrary items from the programming menu (LIGHT/PROFI), which determine the right (see, change). Access w/o password.

Standard equipment is the OM Link interface, which together with operation program enables modification and filing of all instrument settings as well as performing firmware updates (with OML cable). The program is also designed for visualization and filing of measured values from more instruments.

The measured units may be projected on the display.

## OPTION

**COMPARATORS** are assigned to monitor four or eight limit values with relay output. For each input the user may select an arbitrary number of relays with the regime: LIMIT/BATCH/FROM-TO. The limits have adjustable hysteresis within full range of the display and selectable delay of the switch-on within the range of 0...99 s. Reaching the preset limits is signalled by LED and simultaneously by the switch-on of the relevant relay.

**DATA OUTPUTS** are for their rate and accuracy suitable for transmission of the measured data for further projection or directly into the control systems. We offer an isolated RS232 and RS485 with the ASCII/MESSBUS/Modbus/PROFIBUS protocol.

**ANALOG OUTPUTS** will find their place in applications where further evaluating or processing of measured data is required in external devices. We offer universal analog output with the option of selection of the type of output - voltage/current and the option of assigning it to arbitrary input. The value of analog output corresponds with the displayed data. Its type and range are selectable in menu.

**MEASURED DATA RECORD** is an internal time control of data collection. It is suitable where it is necessary to register measured values. Two modes may be used. FAST is designed for fast storage (40 records/s) of all measured values up to 8 000 records. Second mode is RTC, where data record is governed by Real Time with data storage in a selected time segment and cycle. Up to 266 000 values may be stored in the instrument memory. Data transmission into PC via serial interface RS232/485 and OM Link.



# OMB 402UNI



- Horizontal bargraf - 30 LED with display
- Multifunction input (DC, PM, RTD, T/C, DU)
- Digital filters, Tare, Linearization
- Size of DIN 96 x 48 mm
- Power supply 10...30 V AC/DC; 80...250 V AC/DC

## Option

Comparators ● Data output ● Analog output ● Measured data record

The OMB 402 model series are panel programmable three-color bargraphs with auxiliary display designed for maximum efficiency and user comfort while maintaining its favourable price.

The OMB 402UNI is a multifunction instrument with the option of configuration for 8 various input options, easily configurable in the instrument menu.

The instrument is based on a microcontroller and multichannel 24-bit  $\Delta\Delta$  ADC, which secures high accuracy, stability and easy operation of the instrument.

## STANDARD FUNCTIONS

### PROGRAMMABLE PROJECTION

Selection: of input type and measuring range

Measuring range: adjustable, either fixed or with automatic change (OHM)

Setting: manual, optional projection on the display may be set in menu for both limit values of the input signal, e.g. input 0...10 V > 0...850.0

Projection: 30 LED + 6-digit auxiliary display

### EXCITATION

Range: 5...24 VDC/1.2 W, for feeding sensors and transmitters

### COMPENSATION

Wiring (RTD, OHM): automatic (3- or 4-wire) or manual in menu (2-wire)

Probes (RTD): internal wiring (resistance of conductors in the measuring head)

CJC (T/C): manual or automatic (terminal temperature)

### FUNCTIONS

Linearization: non-linear signal is converted by a 50-point linear interpolation

Tare: designed to reset display upon non-zero input signal

Min./max. value: registration of min./max. value reached during measurement

Peak value: the display shows only max. or min. value

Mathemat. operations: polynom, 1/x, logarithm, exponential, power, root, sin x

### DIGITAL FILTERS

Floating / Exponential / Arithmetic average: from 2 to 100 measurements

Rounding: setting the display step for the display

### EXTERNAL CONTROL

Lock: control keys blocking

Hold: display/instrument blocking

Tare: tare activation

Resetting Min/Max: resetting min/max value

